



ANNUAL REPORT FOR 2011

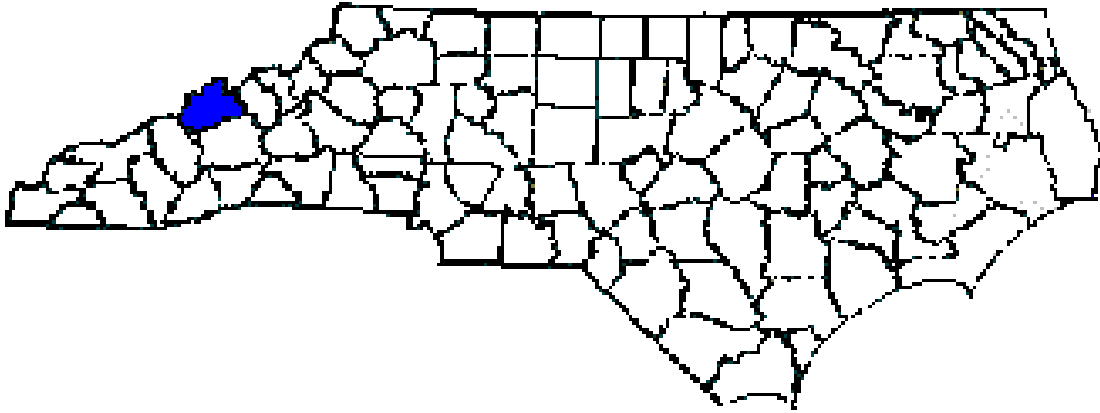

Bailey Branch Site D Mitigation Site
Madison County
TIP No. R-2518A

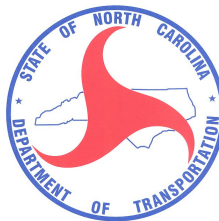

Prepared By:
Natural Environment Unit & Roadside Environmental Unit
North Carolina Department of Transportation
December 2011

TABLE OF CONTENTS

SUMMARY	1
1.0 INTRODUCTION:.....	2
.1 Project Description	2
.2 Purpose	2
.3 Project History	2
.4 Debit Ledger	2
2.0 STREAM ASSESSMENT:	5
.1 Success Criteria	5
.2 Stream Description	5
.2.1 Post Construction Conditions	5
.2.2 Monitoring Conditions	5
.3 Results of Stream Monitoring	6
.3.1 Site Data	6
3.0 VEGETATION	7
.1 Description of Species	7
.2 Results of Vegetation Monitoring	7
.3 Conclusions	7
4.0 OVERALL CONCLUSIONS/RECOMMENDATIONS	7
5.0 REFERENCES:	8

FIGURES

Figure 1 – Vicinity Map	3
Figure 2 – Site D Map	4

TABLES

Table 1 – Site D Morphological Summary	6
--	---

APPENDICES

Appendix A – Cross Sections and Longitudinal Profile

Appendix B – Site Photographs

SUMMARY

The following report summarizes the stream monitoring activities that have occurred during the Year 2011 at the Bailey Branch Site D Mitigation Site in Madison County. The North Carolina Department of Transportation (NCDOT) completed this project and water was turned in November 2008. This report provides the monitoring results for the second formal year of monitoring (Year 2011). The Year 2011 monitoring period was the second of five scheduled years of monitoring on the Bailey Branch Site D Mitigation Site (See Success Criteria Section 2.1).

Based on the overall conclusions of monitoring at the Bailey Branch Site D, it has met the required monitoring protocols for the second formal year of monitoring. The channel throughout the stream restoration/relocation site is stable at this time. The streambank and buffer area have not been planted for the second year of monitoring. NCDOT plans on planting the streambank and buffer area by April 2012. NCDOT will monitor the planted vegetation once it is established. NCDOT will continue stream monitoring at the Bailey Branch Site D Mitigation Site for 2012.

1.0 INTRODUCTION

1.1 Project Description

The following report summarizes the stream monitoring activities that have occurred during the Year 2011 at the Bailey Branch Site D Mitigation Site. Site D is located on US 19 in Madison County at Sta. 31+20 Rt. and Sta. 31+60 Lt. –L- (Figure 1). The Bailey Branch Site D was constructed to provide mitigation for stream impacts associated with Transportation Improvement Program (TIP) number R-2518A in Madison County.

The mitigation site provided approximately 262 linear feet of stream restoration/relocation. Construction was completed and water was turned in November 2008 by the NCDOT. Stream restoration/relocation involved installing several in-stream cross vane structures and planting the riparian buffer zone.

1.2 Purpose

In order for a mitigation site to be considered successful, the site must meet the success criteria. This report details the monitoring in 2011 at the Bailey Branch Site D Mitigation Site. Hydrologic monitoring was not required for this site.

1.3 Project History

November 2008	Construction Completed
November 2008	Water Turned Into Stream
October 2009	As-Built Survey Completed
November 2010	Stream Channel Monitoring (Year 1)
November 2011	Stream Channel Monitoring (Year 2)

1.4 Debit Ledger

The Bailey Branch Site D stream mitigation site did not receive credit due to the site being purchased as Permanent Drainage Easement (PDE).


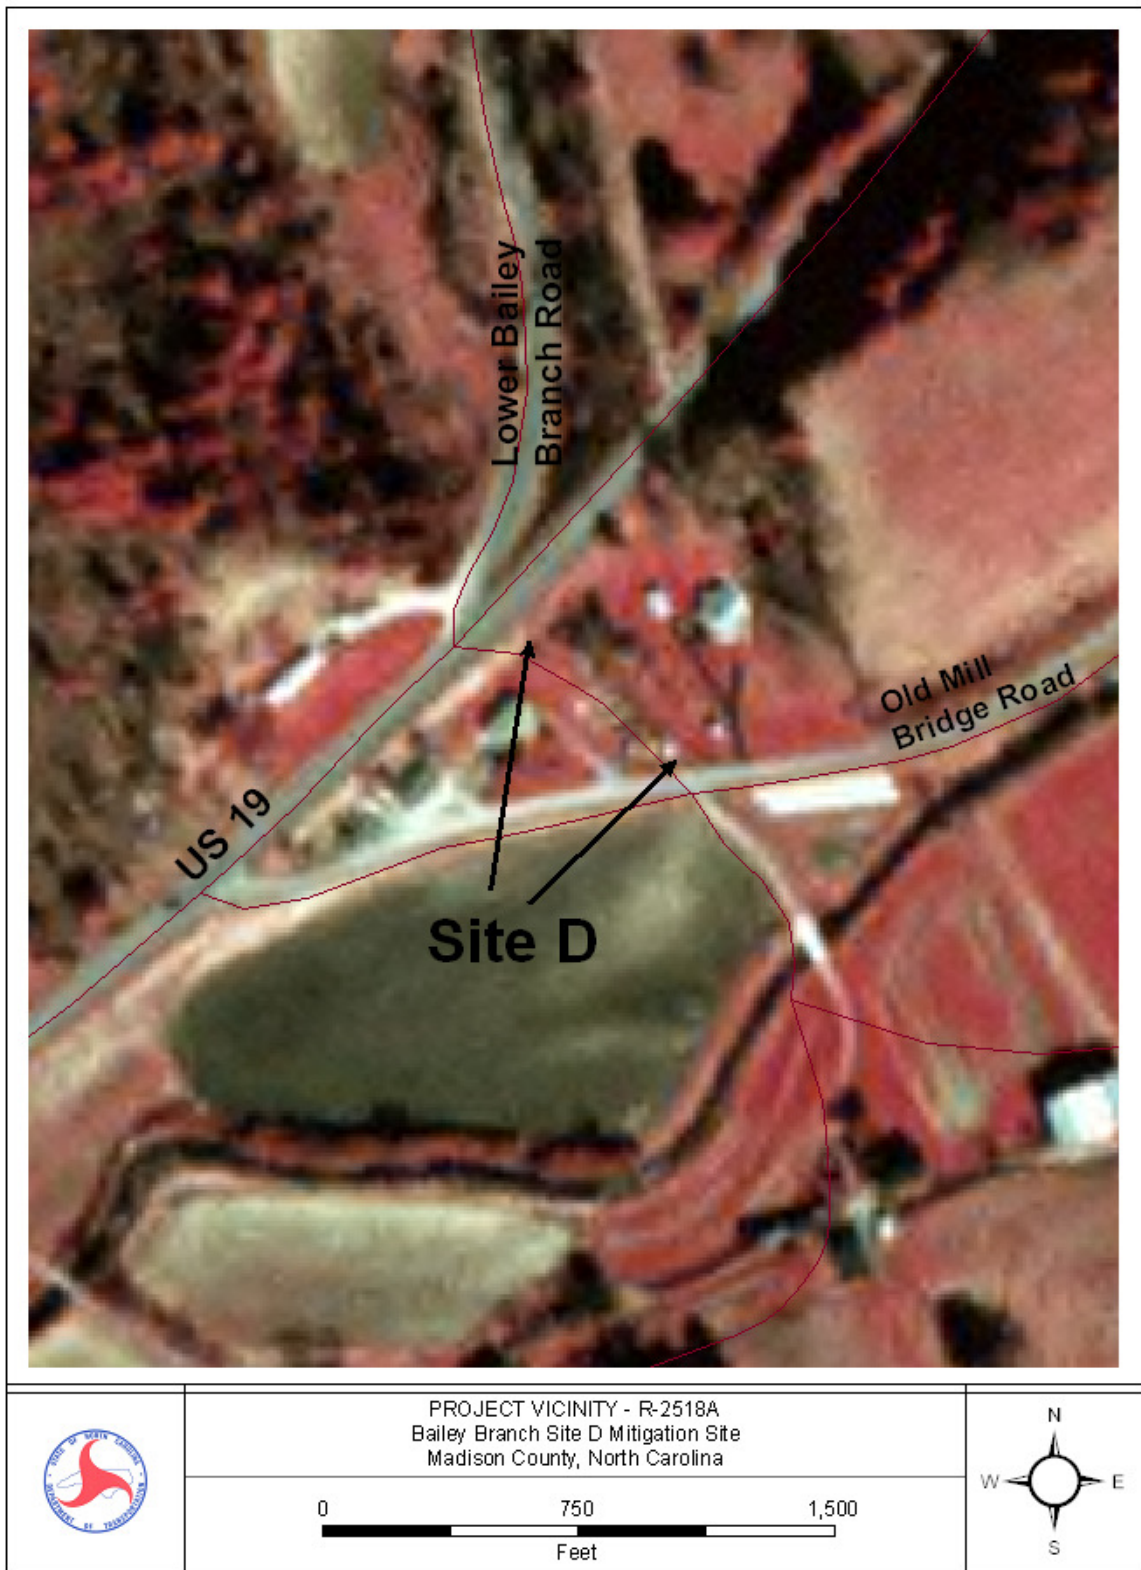


Figure 1. Vicinity Map



4

2.0 STREAM ASSESSMENT

2.1 Success Criteria

The permittee shall monitor the restoration and enhancement mitigation sites following the Level 1 protocols outlined in the "Stream Mitigation Guidelines," dated April 2003 with the following exceptions:

1. Pebble counts shall not be conducted.
2. Two cross sections shall be conducted for streams less than 500 linear feet and five (5) cross sections shall be conducted for streams greater than 500 linear feet.
3. Riparian success shall be by visual inspection of plant survival. Photos will be taken and comments noted on plant survival.

The permittee shall monitor the preservation sites by visual inspection. Photos will be taken and comments noted on plant survival. The monitoring shall be conducted annually for a minimum of five (5) years after final planting. The monitoring results shall be submitted to DWQ in a final report within sixty (60) days after completing monitoring. After 5 years the NCDOT shall contact the DWQ to schedule a site visit to "close out" the mitigation site.

2.2 Stream Description

2.2.1 Post-Construction Conditions

The restoration/relocation of the Bailey Branch Site D Mitigation Site involved installing several in-stream cross vane structures and planting the riparian buffer zone.

2.2.2 Monitoring Conditions

The objective of the Bailey Branch Site D stream restoration/relocation was to restore a B4 stream as identified in Rosgen's Applied River Morphology. A total of two cross sections (one in a riffle and one in a pool) were surveyed. For this report, only cross sections containing riffles were used in the comparison of channel morphology presented below in Table 1 (Site D).

Table 1. Abbreviated Morphological Summary (Bailey Branch Site D)

Variable	Proposed	Cross- Section #1 (Riffle)	Cross- Section #1 (Riffle)	Cross- Section #1 (Riffle)	Cross- Section #1 (Riffle)	Cross- Section #1 (Riffle)
		2010	2011	2012	2013	2014
Drainage Area (mi ²)	0.95	0.95	0.95			
Bankfull Cross Sectional Area (ft ²)	11.2	9.61	2.97			
Maximum Bankfull Depth (ft.)	1.2 – 1.5	1.45	0.71			
Width of the Floodprone Area (ft.)	19	19.54	14.32			
Bankfull Mean Depth (ft.)	0.97	0.79	0.29			
Width/Depth Ratio	12	15.47	34.72			
Entrenchment Ratio	1.7	1.6	1.42			
Bankfull Width (ft.)	11.6	12.22	10.07			

* Riffle values are used for classification purposes, pool values are shown in Appendix A.

2.3 Results of the Stream Assessment

2.3.1 Site Data

The assessment included the survey of two cross sections and the longitudinal profile of the Bailey Branch Site D established by NCDOT after construction. The length of the profile along the Bailey Branch Site D was approximately 200 linear feet. Two cross sections were established during the as-built monitoring year. Cross section locations were subsequently based on the stationing of the longitudinal profile and are presented below. The location of the cross sections and longitudinal profile are shown in Appendix A.

Bailey Branch Site D Cross-Sections:

- ◆ Cross-Section #1: Bailey Branch Site D, Station 103+00, midpoint of riffle
- ◆ Cross-Section #2: Bailey Branch Site D, Station 130+00, midpoint of pool

Based on comparisons of the As-Built to the monitoring data, all of the cross sections appear stable with little or no active bank erosion. Graphs of the cross sections are presented in Appendix A. Future survey data will vary depending on actual location of rod placement and alignment; however, this information should remain similar in appearance. The longitudinal profile showed that the channel was stable for the 2011 monitoring evaluation. Pebble counts were not required per the permit conditions and therefore were not completed.

3.0 VEGETATION: BAILEY BRANCH SITE D

3.1 Description of Species

The following tree species were planted on the streambank:

Salix nigra, Black Willow

Cornus amomum, Silky Dogwood

The following tree species were planted in the buffer area:

Liriodendron tulipifera, Yellow Poplar

Platanus occidentalis, Sycamore

Fraxinus pennsylvanica, Green Ash

Quercus alba, White Oak

3.2 Results of Vegetation Monitoring

Streambank & Buffer Vegetation: Reforestation has not been completed as of the Year 2 monitoring evaluation.

3.3 Conclusions

NCDOT plans on planting the streambank and buffer area by April 2012. NCDOT will monitor the planted vegetation once it is established.

4.0 OVERALL CONCLUSIONS/RECOMMENDATIONS

The Bailey Branch Site D Mitigation Site has met the required monitoring protocols for the second formal year of monitoring. The channel throughout the stream restoration/relocation site is stable at this time. NCDOT plans on planting the streambank and buffer area by April 2012. NCDOT will monitor the planted vegetation once it is established. NCDOT will continue monitoring the Bailey Branch Site D Mitigation Site in 2012.

5.0 REFERENCES

Stream Mitigation Plan, US Highway 19, R-2518A On-Site Mitigation
Madison County, North Carolina, August 2006.

Design Plans for R-2518A, US 19 from I-26 to 0.8 KM east of the Yancey Co.
Line, Stream Mitigation (Preservation, Enhancement, and Restoration),
HSMM.


North Carolina Department of Transportation (NCDOT), April 29, 2008. 404 and
401 Individual Permits for R-2518A and R-2518B (ACOE Permit No. 2007-
2197-357/300 and DWQ Project No. 20071134, Individual Certification No.
3706).

Rosgen, D.L, 1996. Applied River Morphology. Wildland Hydrology, Pagosa
Springs, Colorado.

US Army Corps of Engineers (USACE), 2003. Stream Mitigation Guidelines.
Prepared with cooperation from the US Environmental Protection Agency,
NC Wildlife Resources Commission, and the NC Division of Water Quality.


APPENDIX A

CROSS SECTIONS AND LONGITUDINAL PROFILE

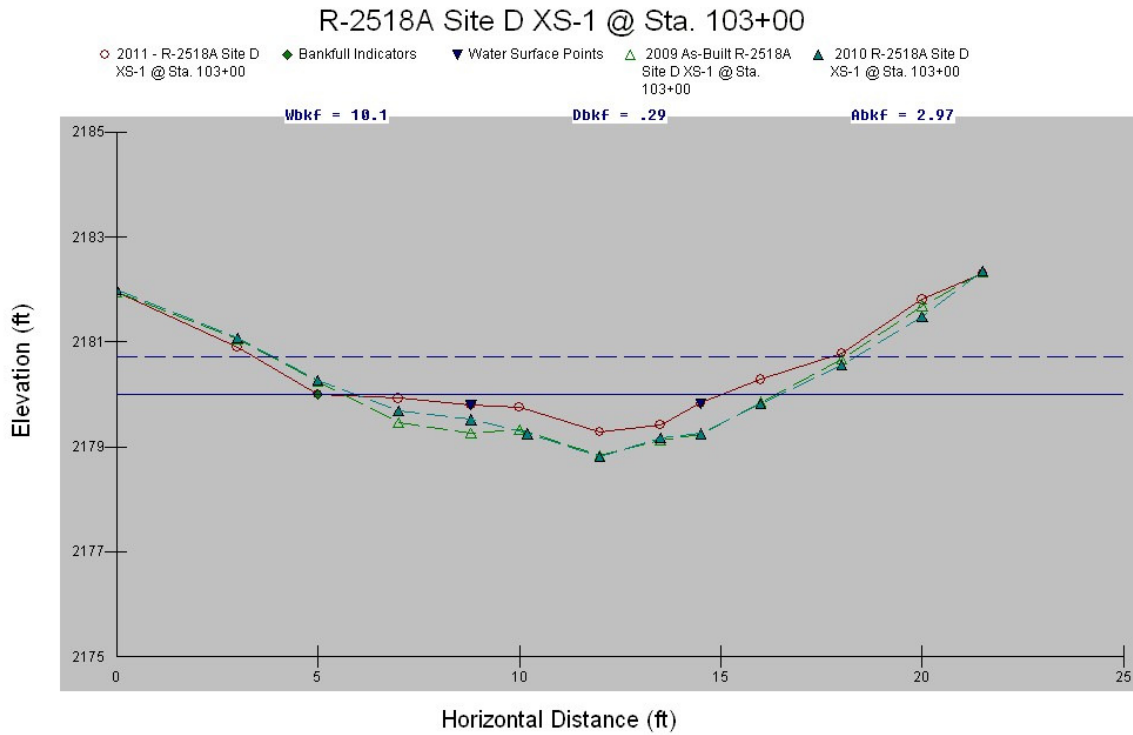

Site D: Cross-Section #1 (Riffle) Abbreviated Morphological Summary					
	2010	2011	2012	2013	2014
Bankfull Cross Sectional Area (ft ²)	9.61	2.97			
Maximum Bankfull Depth (ft.)	1.45	0.71			
Width of the Floodprone Area (ft.)	19.54	14.32			
Bankfull Mean Depth (ft.)	0.79	0.29			
Width/Depth Ratio	15.47	34.72			
Entrenchment Ratio	1.6	1.42			
Bankfull Width (ft.)	12.22	10.07			


R-2518A Site D XS-2 @ Sta.130+00

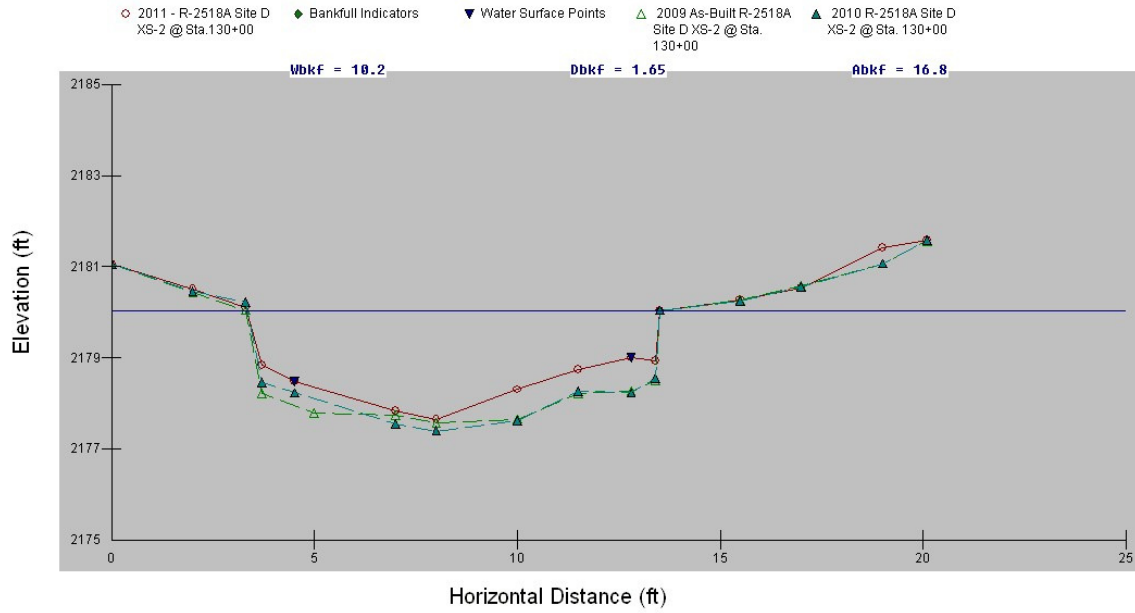

Site D: Cross-Section #2 (Pool) Abbreviated Morphological Summary					
	2010	2011	2012	2013	2014
Bankfull Cross Sectional Area (ft ²)	21.23	16.78			
Maximum Bankfull Depth (ft.)	2.65	2.38			
Bankfull Mean Depth (ft.)	2.09	1.65			
Bankfull Width (ft.)	10.16	10.17			

*According to the Rosgen Classification of Natural Rivers floodprone width, entrenchment ratio, and width depth ratio are not measured in pool, glide, or run features.

2011 R-2518A Site D Profile

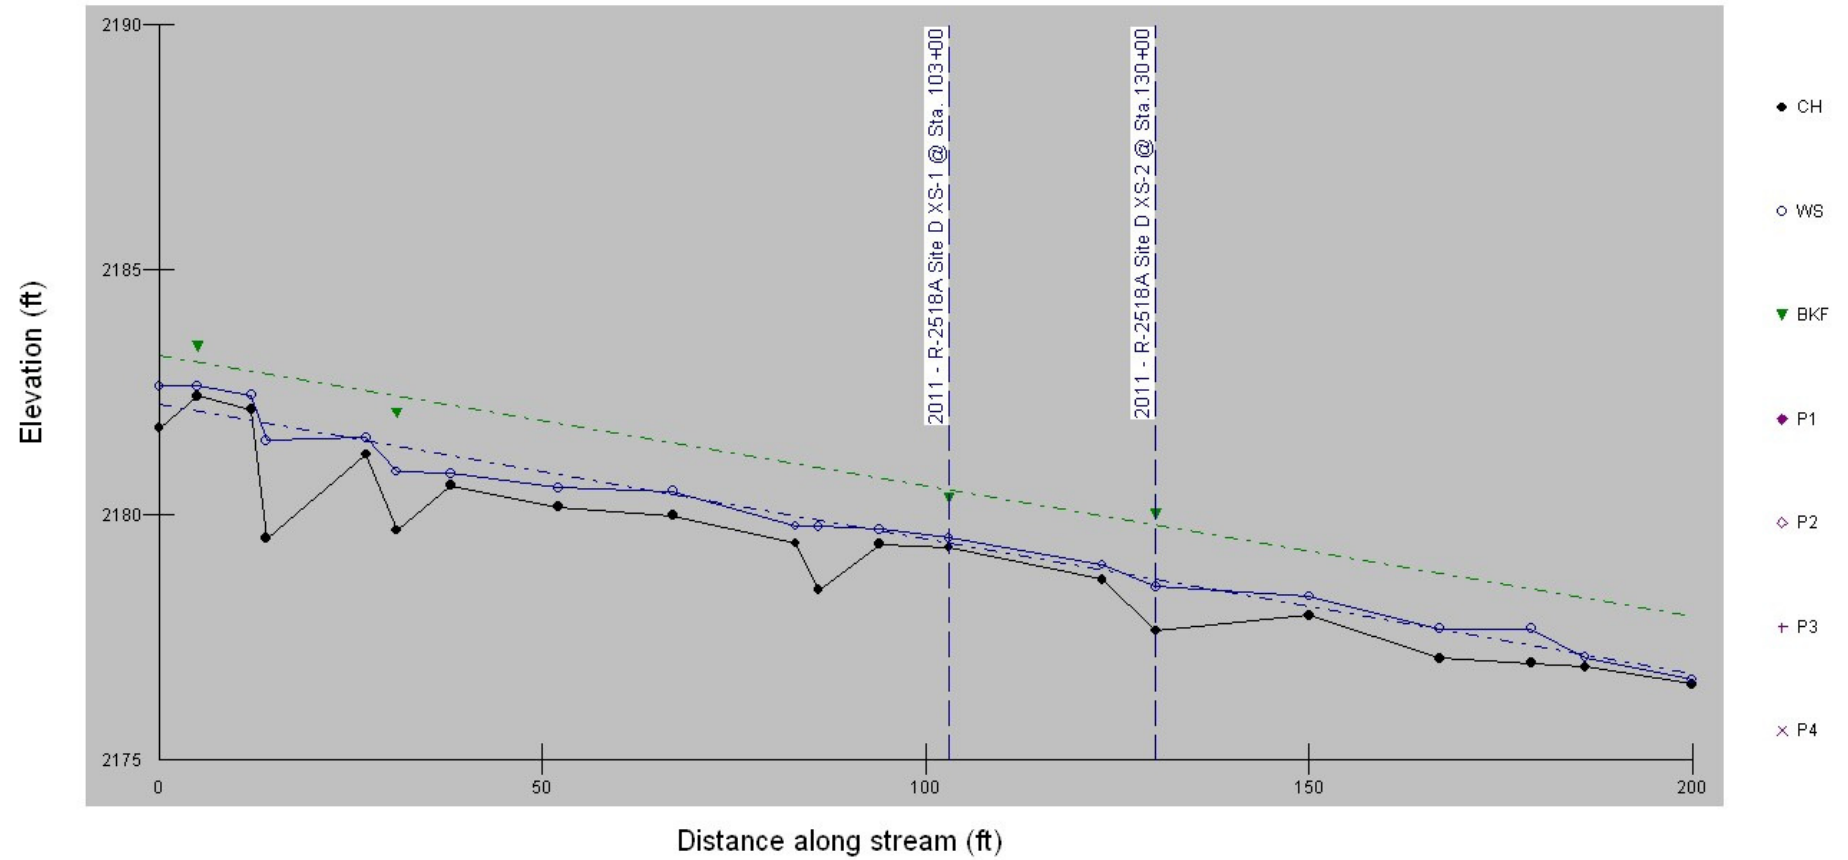

APPENDIX B
SITE PHOTOGRAPHS

Bailey Branch Site D



Photo Point #1 (Upstream)



Photo Point #1 (Downstream)



Photo Point #2 (Upstream)



Photo Point #2 (Downstream)



Photo Point #3 (Upstream)



Photo Point #3 (Downstream)

November 2011

Bailey Branch Site D



Overview Photo
November 2011